双面，页面 197*140mm

Indication message

a) Low battery indication. When "🔋" is shown, please replace the batteries.

b) Overload indication. Please remove the weight on the scale to protect the loadcells.

c) Negative weight indication. It will be shown when taking the weight from the platform, under "Tare" setting.

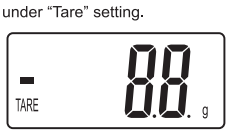

Reminder

a) Please do not put the scale on carpet.

b) Please put the weight object in the center of the scale platform to obtain a more accurate weight.

c) Please do not put items on platform when switch on.

d) If the scale is not to being used for a long period, please remove the batteries.

e) Clean the scale with a slightly damp cloth, DO NOT immerse the scale in water or use chemical/abrasive cleaning agents.

f) To maximize battery life touch " On/Off ZERO " for two seconds after use to switch off .

Max 10KG

KITCHEN SCALE

PET SCALE

POST SCALE

Max 10kg, Div 1g
unit:g/ml/oz/lb.oz
LCD VA: 40*18mm
white backlight display
powered by 2xAAA
tare, auto off function
unit size: 293x183x70mm

MADE IN CHINA

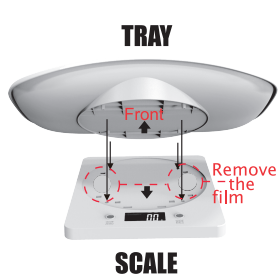

Please Remove the top film on the two round adhesive tape, and combine the tray and the scale together According to the direction of arrow.

托盘与秤体组装时，请按产品上标识的方向对齐四个孔位,并撕开两个圆形双面海棉胶上隔离纸，将托盘与秤体压紧.

User Manual

Features

- ✧ Capacity: 10kg
- ✧ Division: 1g
- ✧ Weight unit: g /oz/ lb'oz / ml
- ✧ Minimal weight: 2g
- ✧ Function key: On/Off ZERO , mlOZ g lb.oz
- ✧ Display: LCD with white backlight
- ✧ Battery: 2xAAA
- ✧ Dimension: 293x183x70 mm
- ✧ Auto off function

LCD diplay



Symbol	Description
▬	Negative weight
TARE	Tare function
🔋	LOW battery

Function indication

- ✧ On/Off ZERO : Press " On/Off ZERO " to switch on to enter weighing mode;

  Press and hold " On/Off ZERO " for about 2s to switch off;

  Press " On/Off ZERO " to make tare function in weighing mode.
- ✧ mlOZ g lb.oz : Press "mlOZ g lb.oz" to select desired unit in weighing mode;

Operation instruction

I. Select unit before use

a) Open the battery door at the back of the scale.

b) Put the batteries in and ensure +/- terminals are correct. The LCD will be on as below.



c) Close the battery door and put the scale on flat table. The scale will enter weighing mode automatically.

Note: If there is a weight shown on the LCD, please press " On/Off ZERO " to set it to zero.

d) Press "mlOZ g lb.oz" to select desired unit.

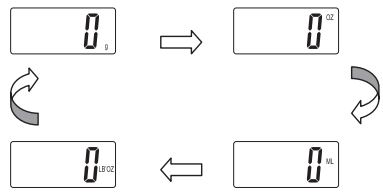

Note: When finishing selecting unit, you may start to weigh according to the weighing procedure below. If there is not any operation and the weight is steady in weighing mode, the scale will turn off automatically after about 45 seconds.

II. Weighing (unit g selected)

a) Please put the scale on hard flat table.

b) Press " On/Off ZERO " to switch on.



c) You can start to weigh when "0" is shown on the LCD.