


ASSEMBLY AND INSTALLATION INSTRUCTIONS

WARNING: TO AVOID RISK OF ELECTRICAL SHOCK, BE SURE TO SHUT OFF POWER WHILE INSTALLING OR SERVICING THIS FIXTURE.

NOTES: 1. Before installing, consult local electrical codes for wiring and grounding requirements.
2. READ AND SAVE THIS INSTRUCTION.

Hardware Package (included):

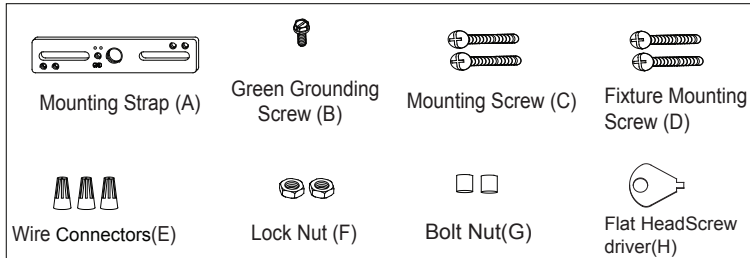

Installation Steps

Turn off the power at fuse or circuit box.

1. Fastening cable by screwing plastic headless screw, using flat head screwdriver(H).
2. Measure the desired length of the cable (A) from the canopy to the top side of the cap nut and leave an additional 9" of cable (B) above the canopy (include the canopy). Then cut off the unnecessary cable. (See Figure 1)
3. Adjust strain relief at 9" position from the top of the cord.
4. Mark the 3" of cord (C) from the top of the cord (B). Use a knife to peel off the insulation of the cord (C) carefully to expose the 3 wires on the inside. (See Figure 1)
Caution: Cutting too deep may cut off the three inside wires and destroy the insulation surface of the three inside wires.
5. Peel off the wire from the top about 3/8" long(D) to expose the copper wires.
6. Attach the mounting strap to the outlet box by using two mounting screws.
7. Pull out the outlet wires and the house grounding wire from the outlet box. Make wire connections using the wire nuts:
 - a. The black wire from the fixture to the black wire from the power source.
 - b. The white wire from the fixture to the white wire from the power source.
 - c. The green grounding wire from the fixture to the green grounding wire from power source. Carefully put wires back into the outlet box.

8. Pull the cord (A) down slightly until the strain relief touches the hex nut.


Note: Adjusting the strain relief of the canopy can decrease or increase the length of cord that is exposed.

9. Attach the fixture canopy to the mounting strap by inserting the screws, and secure it with two bolt nuts.

10. Install a bulb (not included). See relamping label at socket area or packaging for maximum allowed wattage.







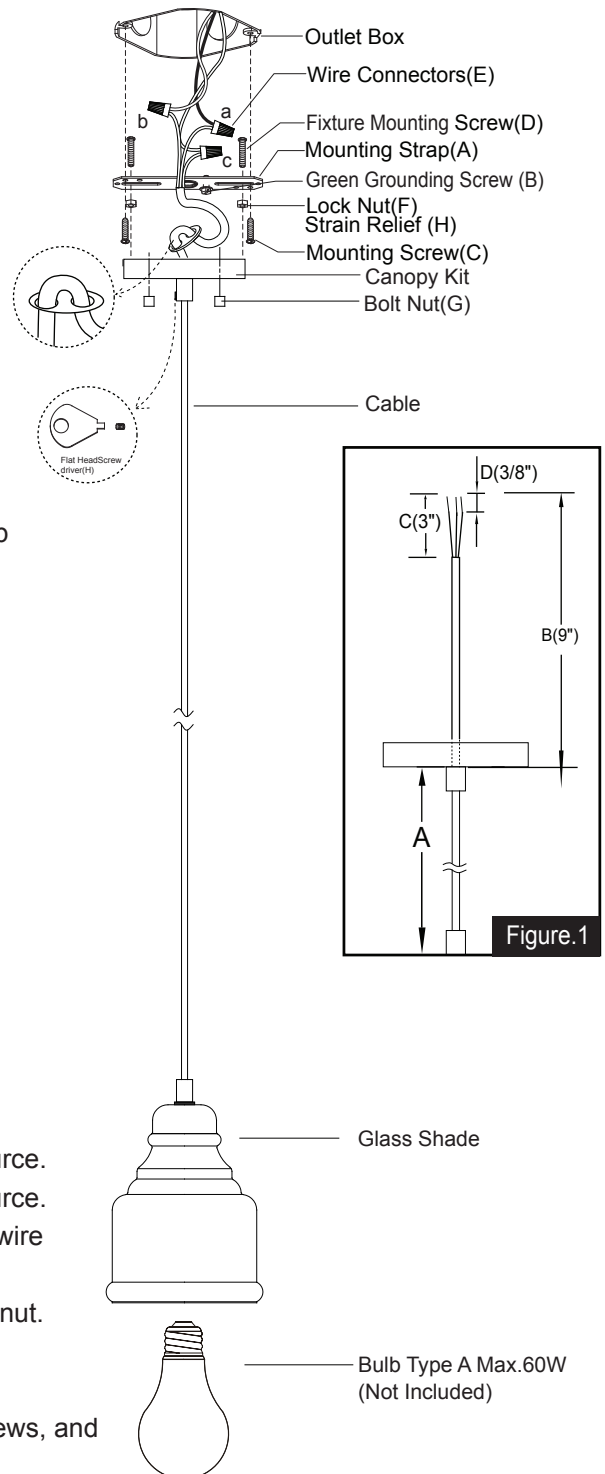

11. Turn on the power at the main fuse or circuit breaker box.

Turn on the power at fuse or circuit box.




The following parts are available for re-order if damaged or missing.

Spare Parts List:

			
Mounting Strap (A)	Green Grounding Screw (B)	Mounting Screw (C)	Fixture Mounting Screw (D)
			
Wire Connectors(E)	Lock Nut (F)	Bolt Nut(G)	Flat HeadScrew driver(H)

→ Mounting Hardware

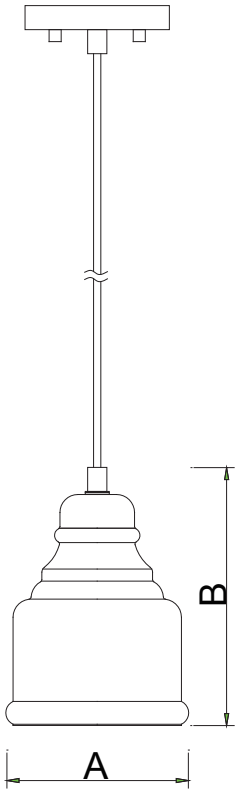

A: 6"
B:8-1/4"