


ASSEMBLY & INSTALLATION INSTRUCTIONS

A720

Erlenmeyer Mini Pendant 187200

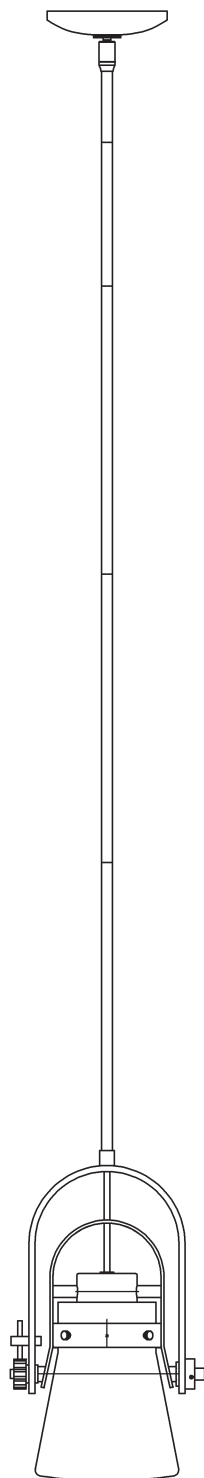

HUBBARDTON FORGE.

MODERN AMERICAN BLACKSMITHS | FINE, HAND CRAFTED LIGHTING
CASTLETON, VERMONT USA | HUBBARDTONFORGE.COM

48301

1 OF 5

Component Parts

- A Strain Relief Tab**
- B Fixture Coupling**
- C Crossbar**
- D Jam Nut**
- E Threaded Nipple**
- F Ground Screw**
- G Canopy Ring**
- H Canopy**
- I Swivel**
- J 3" Fixture Pipe (1)**
- K 6" Fixture Pipe (1)**
- L 12" Fixture Pipe (3)**
- M Stem Nipple (6)**
- N Bulb (not included)**
- O Glass**
- P Thumb Screws (4)**
- Q Pin**



ASSEMBLY & INSTALLATION INSTRUCTIONS

A720

Erlenmeyer Mini Pendant 187200

CAUTION: FAILURE TO INSTALL THIS FIXTURE PROPERLY MAY RESULT IN SERIOUS PERSONAL INJURY OR DEATH AND PROPERTY DAMAGE. We recommend installation by a licensed electrician. This product must be installed in accordance with applicable installation code(s), by a person familiar with the construction and operation of the product and the hazards involved.*

Caution: Do not exceed maximum wattage noted on fixture. Use only recommended bulbs with fixture.

Please Note: After installation extra hardware and accessories are possible due to our kits are used on multiple products and options.

To Install Fixture (Figure 1) on following page

CAUTION: BE SURE POWER IS OFF AT THE MAIN BREAKER BOX PRIOR TO INSTALLATION.

1. Carefully unpack fixture (A) from the carton.
2. Thread jam nut (D) and crossbar (C) onto threaded nipple (E) with ground screw (F) facing towards swivel (I); leave both parts loose.
3. Using two machine screws (not provided), temporarily fasten crossbar (C) to the electric box.

NOTE: A NEW ELECTRIC BOX COMES WITH SCREWS. WHEN REPLACING A FIXTURE, RETAIN THE EXISTING SCREWS FOR USE WITH THE NEW FIXTURE.

4. Adjust the length of threaded nipple (E) in crossbar (C) so that canopy ring (G) will hold canopy (H) against the ceiling with no threads showing for best appearance. When the correct adjustment is established, tighten jam nut (D) against crossbar (C) to secure the adjustment.
5. Remove crossbar (C) from the electrical box and proceed with the assembly instructions.
6. Locate fixture pipes and stem nipples (J, K, L, M). Nipples (M) can be found in the kit bag.
7. Provided are multiple fixture pipes in three different lengths. Choose the combination that will achieve the overall height desired. Refer to the table below to determine the pipes required to reach the desired overall height. Once you have determined the components necessary, feed braided sleeving through fixture coupling (B). Allow approximately 8 1/2" of slack in the braiding between the fixture coupling (B) and socket cup to allow for adjustment of the fixture angle. Wires will slip easier through loose components than through pipes and couplings that are pre-assembled. Once wires are run, apply thread locking compound to all the connection points and assemble the pipes and nipples.

		Overall Height of Fixture															
		16	19	22	25	28	31	34	37	40	43	46	49	52	55	58	61
# of Pipes Required	3" Pipe (J)		1		1		1		1		1		1		1		1
	6" Pipe (K)			1	1			1	1		1		1			1	1
	12" Pipe (L)					1	1	1	1	2	2	2	2	3	3	3	3

NOTE: APPLICATION OF THE THREAD LOCKING COMPOUND IS NECESSARY TO PREVENT THE PIPE FROM LOOSENING DURING REGULAR MAINTENANCE AND CLEANING OF THE FIXTURE. BE CERTAIN TO APPLY THE COMPOUND.

8. Carefully slide canopy ring (G) and canopy (H) over wires and fixture pipes (J, K, L) until they rest on fixture (A).
9. Slip wires from the fixture (A) through assembled swivel (I) and thread swivel onto final pipe. It may be necessary to remove a nipple (M) for this to work on shorter overall fixture heights.
10. Refer to instructions on next page to continue installation.



HUBBARDTON FORGE.

MODERN AMERICAN BLACKSMITHS | FINE, HAND CRAFTED LIGHTING
CASTLETON, VERMONT USA | HUBBARDTONFORGE.COM

48301

3 OF 5

ASSEMBLY & INSTALLATION INSTRUCTIONS

A720

Erlenmeyer Mini Pendant 187200

11. Weave black and white wires from fixture through strain relief (A). Strain Relief can be found in the kit bag. Slide strain relief up tight to the backside of the crossbar.
12. Using two machine screws (not provided), fasten crossbar (C) to the electric box.
13. Using suitable wire connectors (not provided) connect fixture wires to supply (white/ribbed to white and black/smooth to black). Attach a pigtail lead to crossbar ground screw (F). Hold canopy (H) close, connect all ground wires (bare copper or green to bare copper or green).


CAUTION: MAKE SURE WIRE CONNECTORS ARE TWISTED ON SECURELY, AND NO BARE WIRE IS EXPOSED.

14. Slide canopy (H) against ceiling, and secure with canopy ring (G).

CAUTION: BE SURE NO WIRES ARE PINCHED BETWEEN CANOPY (H) AND THE CEILING.

15. Refer to Figure 2 on the next page.
16. Install Bulb (N, Not Included)
17. Loosen thumbscrews (P) . It is not necessary to remove thumb screws.
18. Slip glass (O) into ring aligning groove in glass with thumb screws (P) Tighten thumbscrews. Be careful not to over-tighten screws.
19. Glass angle is adjustable. To rotate remove pin (Q) and rotate fixture center to desired angle and insert pin thru tab and into gear.
20. Caution: When adjusting the angle of the fixture, be sure not to pull on the braided sleeving that covers the fixture wires. There is only approximately 12" of braided sleeving supplied with the fixture. If the braided sleeving is pulled out of the pipe it is difficult to push it back in. If the sleeving does pull out of the pipe, squeeze the end of the braided sleeving tight against the fixture wires and feed into the fixture coupling and pipe a little at a time. When adjusting the bushing at the top of the fixture might pull up slightly. When adjustment is complete push bushing back into the hole.

21. Restore electricity at main breaker

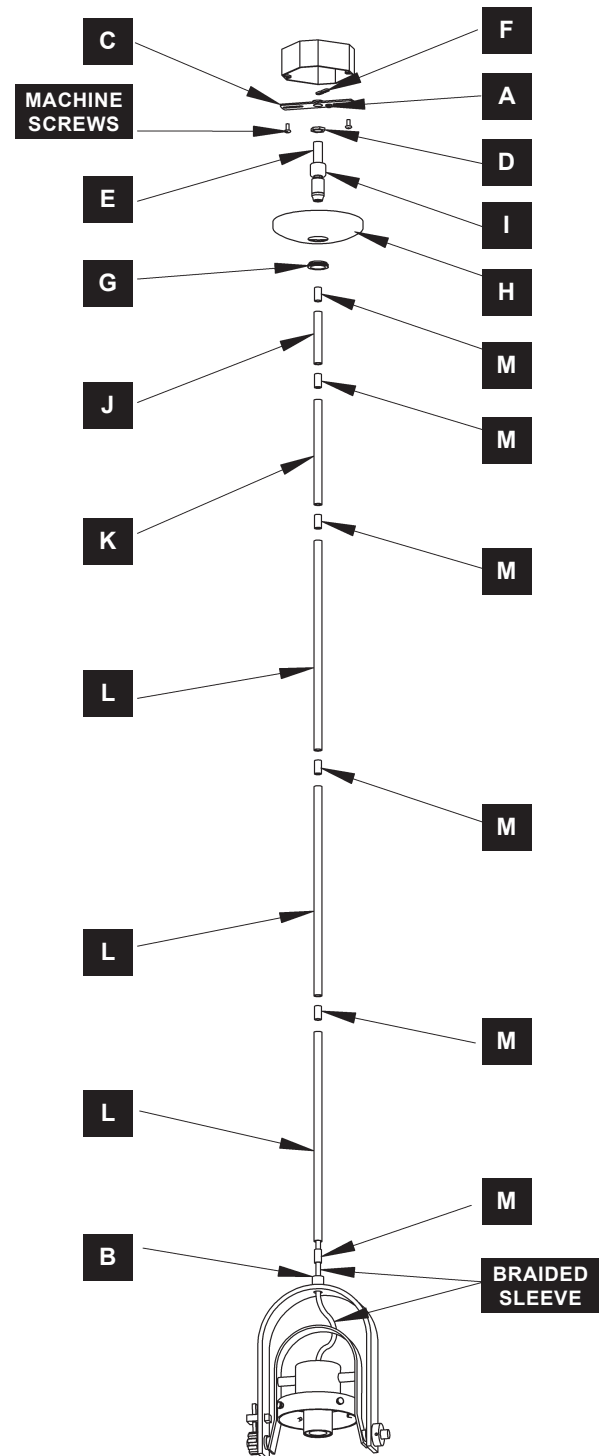

(Figure 1)



HUBBARDTON FORGE.

MODERN AMERICAN BLACKSMITHS | FINE, HAND CRAFTED LIGHTING
CASTLETON, VERMONT USA | HUBBARDTONFORGE.COM


48301

4 OF 5

ASSEMBLY & INSTALLATION INSTRUCTIONS

Erlenmeyer Mini Pendant 187200

A720

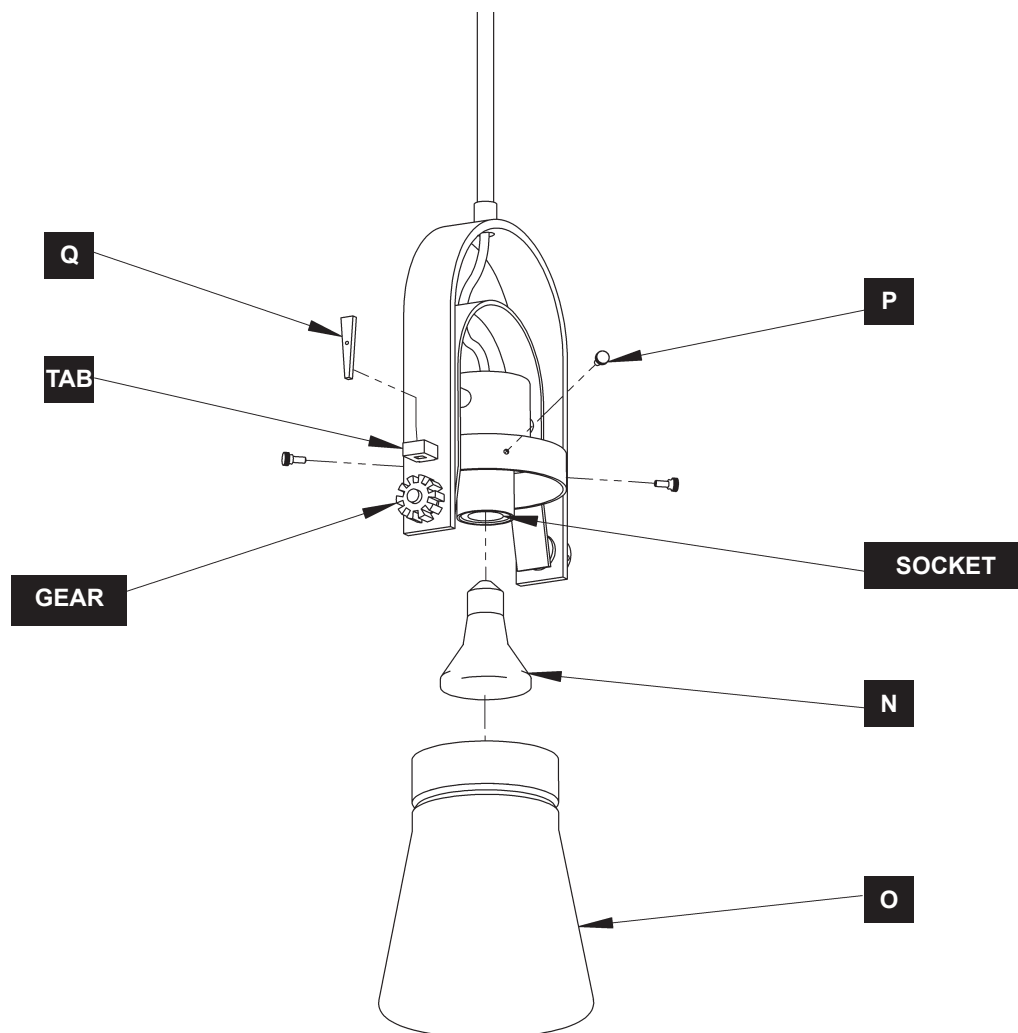

(Figure 2)

If you need further assistance, or find that you are missing any parts, please contact the dealer from which you purchased this product. We hope you enjoy your fixture!

**Hubbardton Forge will not be liable for injury or damage caused by improper installation, lamping or use of this fixture.*



HUBBARDTON FORGE.

MODERN AMERICAN BLACKSMITHS | FINE, HAND CRAFTED LIGHTING
CASTLETON, VERMONT USA | HUBBARDTONFORGE.COM

48301

5 OF 5